

DEPARTMENT OF TRANSPORTATION**DIVISION OF ENGINEERING SERVICES**

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave.St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:**Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-021607**Date Inspected:** 12-Nov-2010**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Xu Le Feng /Qiu Wen**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG Bike Path**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance (QA) Inspector, Scott Leavitt, was present during the times noted above for observations relative to the work being performed.

Bay 10 – Tower Shop

In Process Inspection FCAW

This QA Inspector observed the following work in progress: FCAW welding of weld joint 1,2 located on GGL-MQ-2021-9. Welder is identified as 052075. ZPMC Quality Control (QC) is identified as Qui Wen. The welding variables recorded by QC appeared to comply with the Applicable WPS.

This QA Inspector observed the following work in progress: FCAW welding of weld joint 1,2 located on GGL-MQ-2021-48. Welder is identified as 057180. ZPMC Quality Control (QC) is identified as Qui Wen. The welding variables recorded by QC appeared to comply with the Applicable WPS.

Bay 11 – Tower Shop

In Process Inspection FCAW

This QA Inspector observed the following work in progress: FCAW welding of weld joint located on SD1-BRSAS 1-60 WSD1-FESA6. Welder is identified as 047218. ZPMC Quality Control (QC) is identified as Xu Le Feng. The welding variables recorded by QC appeared to comply with the Applicable WPS.

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

This QA Inspector observed the following work in progress: FCAW welding of weld joint 070 located on BK004A6-022. Welder is identified as 047218. ZPMC Quality Control (QC) is identified as Xu Le Feng. The welding variables recorded by QC appeared to comply with the Applicable WPS.

This QA Inspector observed the following work in progress: FCAW welding of weld joint 016 located on BK008A2-002. Welder is identified as 042218. ZPMC Quality Control (QC) is identified as Xu Le Feng. The welding variables recorded by QC appeared to comply with the Applicable WPS.

This QA Inspector observed the following work in progress: FCAW welding of weld joint 023 located on BK005A4-004. Welder is identified as 040723. ZPMC Quality Control (QC) is identified as Xu Le Feng. The welding variables recorded by QC appeared to comply with the Applicable WPS.

In Process Inspection SMAW

This QA Inspector observed the following work in progress: SMAW welding of weld joint 015 located on BK004A2-020-015. Welder is identified as 047218. ZPMC Quality Control (QC) is identified as Xu Le Feng. The welding variables recorded by QC appeared to comply with the Applicable WPS. See picture for additional information.

This QA Inspector observed the following work in progress: SMAW welding of weld joint located on ND1-BRSA5-2-3B. Welder is identified as 040724. ZPMC Quality Control (QC) is identified as Xu Le Feng. The welding variables recorded by QC appeared to comply with the Applicable WPS. See picture for additional information

Visual Inspection

The following Non Destructive Testing (NDT) inspection carried out as per the ZPMC submitted Notification No 07327.

This QA inspector performed VT of an area that has been previously tested and accepted by ZPMC Quality Control (QC) personnel.

The members are identified as:

BK004A4-019-015
BK004A7-019-091, 092
BK004A4-019-040, 041
BK004A7-019-097, 098, 103,104
BK004A4-019-066, 067
BK004A7-019-109, 110, 115, 116

Magnetic Particle Inspection (MT)

The following Non Destructive Testing (NDT) inspection carried out as per the ZPMC submitted Notification No 07327.

This QA inspector performed MT of approximately 15% of an area that has been previously tested and accepted by ZPMC Quality Control (QC) personnel. This QA Inspector generated an MT report for this date.

The members are identified as:


BK004A4-019-015
BK004A7-019-091, 092

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

BK004A4-019-040, 041
BK004A7-019-097, 098, 103,104
BK004A4-019-066, 067
BK004A7-019-109, 110, 115, 116

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

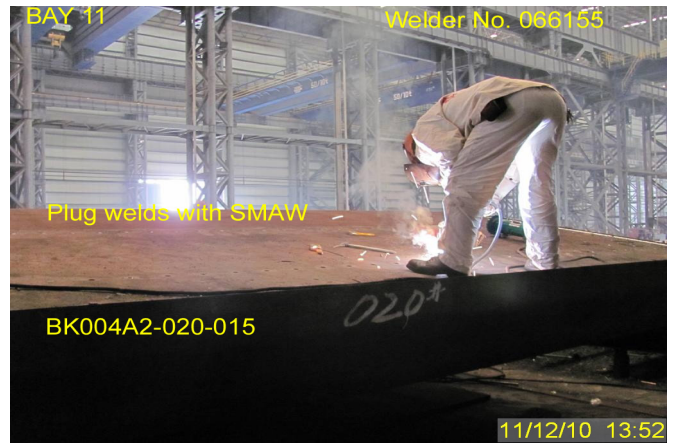

Summary of Conversations:

No relevant conversations.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang at 15000422372, who represents the Office of Structural Materials for your project.

Inspected By:	Leavitt, Scott	Quality Assurance Inspector
Reviewed By:	Clifford, William	QA Reviewer
